AX-9341 - Digital Thermometer

1. Function

- ON/OFF
- H/T
- IP 67
- ONE HOUR AUTO SHUT OFF

2. Feature

- Stainless steel sensor probe
- 1 second normal temperature sensing time
- Low battery indicator

3. Specification

- Measurement range
-50°C - +150°C or -58°F - +302°F
- Resolution
0,1° for -19,9° - +199,9°, otherwise 1°
- Accuracy
±1°C in the range of -20°C - +150°C, otherwise more than ±2°C; ±1,8°F in the range of -4°F - +302°F, otherwise more than ±4°F
- Ambient temperature for plastic case
0°C - +50°C or +32°F - +122°F
- Battery
1x1,5 volts "393" size or equivalent

4. Installation

- Unpack the thermometer with care
- Open the battery door and install battery into the battery compartment. Then close the battery door.
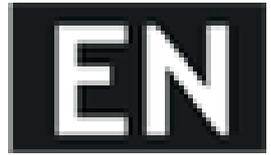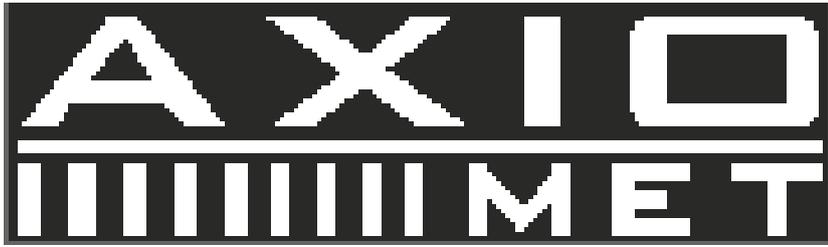
- Untie the sensor wire, the thermometer is now ready for use.
- Replace a battery when the low battery indicator appears on the display.

5. Operation

- ON/OFF - press "ON/OFF" button for on/off switching.
- H/T - press "H/T" button to retain reading for recording. HOLD sign flashes on the display to indicate the holding position.

6. Precaution

- To obtain the best results, probe tip should be immersed at least 10 mm into tested substance.
- Make sure battery is installed with correct polarity as shown in battery compartment.
- Remove battery from battery compartment if the thermometer will not be used for a long duration of time or during storage.
- The thermometer cannot be used or put inside any oven or microwave.
- Plastic o-ring must be placed at the appropriate position after opening the battery door to ensure water-proff function (for product with waterproof function only).
- Only use the thermometer for its intended purpose, using the thermometer in an unauthorised way will void the warranty.

7. Changing battery